USAF OEHL TR 82-9



CHLORDANE IN AIR FORCE FAMILY HOUSING:

A STUDY OF HOUSES TREATED PRIOR TO CONSTRUCTION

JUNE 1982

Approved for public release; distribution unlimited



A

USAF Occupational and Environmental Health Laboratory
Aerospace Medical Division (AFSC)
Brooks Air Force Base, Texas 78235

HIE FILE COPY

AD A 121654

23 139

When U.S. Government drawings, specifications, or other data are used for any purpose other than a definitely related Government procurement operation, the Government thereby incurs no responsibility nor any obligation whatsoever, and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise, as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

The mention of trade names or commercial products in this publication is for illustration purposes and does not constitute endorsement or recommendation for use by the United States Air Force.

Do not return this copy. Retain or destroy.

Please do not request copies of this report from the USAF Occupational and Environmental Health Laboratory. Additional copies may be purchased from:

National Technical Information Service 5285 Port Royal Road Springfield, Virginia 22161

Government agencies and their contractors registered with the DTIC should direct requests for copies of this report to:

Defense Technical Information Center (DTIC) Cameron Station Alexandria, Virginia 22314

This report has been reviewed by the Public Affairs Office and is releasable to the National Technical Information Service (NTIS). At NTIS, it will be available to the general public, including foreign nations.

This technical report has been reviewed and is approved for publication.

WILLIAM E. MABSON, Colonel, USAF, BSC

Commander

SECURITY CLASSIFICATION OF THIS PAGE (When Date Entered)

REPORT DOCUMENTATION PAGE	READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER 2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
USAF OEHL Technical Report 82-9	
4. TITLE (and Subtitle)	5. TYPE OF REPORT & PERIOD COVERED
Chlordane in Air Force Family Housing: A Study of Houses Treated Prior to Construction	Final
	6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s)	8. CONTRACT OR GRANT NUMBER(s)
Thomas H. Lillie, Capt, USAF, BSC	
9. PERFORMING ORGANIZATION NAME AND ADDRESS	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
USAF Occupational and Environmental Health	AREA & WORK ON I NUMBERS
Laboratory	1
Brooks AFB, TX 78235	
11. CONTROLLING OFFICE NAME AND ADDRESS	12. REPORT DATE
USAF Occupational and Environmental Health	June 1982
Laboratory	13. NUMBER OF PAGES
Brooks AFB, TX 78235 14. MONITORING AGENCY NAME & ADDRESS(if different from Controlling Office)	15. SECURITY CLASS. (of this report)
	Unclassified
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report)	
Approved for public release; distribution unlimited	1.
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from	m Report)
18. SUPPLEMENTARY NOTES	
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)	
chlordane termite treatment	
air sampling	
family housing	
Tamily housing	
ABSTRACT (Continue on reverse side if necessary and identity by block number) Airborne chlordane levels were measured in 2,113 fa installations during the winter and spring of 1981- were in or below the slab in all houses. Also, the treated with chlordane before the slabs were poured tion. The airborne chlordane concentration exceeds in only 2 of the houses. It is recommended that pl that were treated only prior to construction be can	escaled because the probabil-
ity of exceeding the action level is extremely low.	<u>-</u>

DD 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED .

USAF OCCUPATIONAL AND ENVIRONMENTAL

HEALTH LABORATORY

Brooks AFB, Texas 78235

CHLORDANE IN AIR FORCE FAMILY HOUSING: A STUDY OF HOUSES TREATED PRIOR TO CONSTRUCTION

JUNE 1982

Prepared by:

THOMAS H. LILLIE, Captain, USAF, BSC

Chief, Environmental Entomology Function

CHARLES E. THALKEN, Lt Colonel, USAF, BSC Chief, Environmental Assessment Branch

Approved by:


ARTHUR P. CALDWELL, Colonel, USAF, BSC

Chief, Consultant Services Division

TABLE OF CONTENTS

		PAGE
I.	INTRODUCTION	1
II.	MATERIALS AND METHODS	1
III.	RESULTS	2
IV.	DISCUSSION	4
v.	CONCLUSIONS	5
vi.	RECOMMENDATIONS	5
	Literature Cited	_



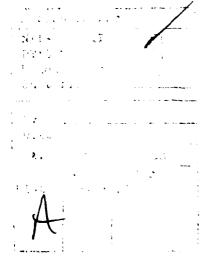

Acknowledgements

All samples were analyzed by the Environmental Chemistry Department, Research Triangle Institute, Research Triangle Park NC. Mr Don Cosgrove, USAFSAM/BR, was consulted for the statistical analysis. The following USAF OEHL staff assisted with this project:

1Lt R.I. Nakasone Capt R.B. Drawbaugh Capt R. Bennett Capt C. Howarth

Mr T.C. Thomas Mr Y.A. Nishioka Capt T. Berridge

I. INTRODUCTION

Airborne chlordane contamination has been reported in Air Force (Callahan 1970), Army (Vinopal and Olds 1977) and civilian (Malina et al. 1959; Savage 1975; Wright and Leidy 1982) houses following treatment for termites. Contamination has occurred in newly constructed houses that were pretreated (unpublished data) as well as in older houses treated by subslab injection (Callahan 1970). In all cases, the ventilation system was in close proximity to the treated soil.

The Air Force has conducted extensive tests in houses with ventilation ducts in or below the slab. Callahan (1970) investigated two houses at Webb AFB TX after 15 gallons of a 2% chlordane solution was accidently injected into the subslab ducts. Other studies were conducted at Wright-Patterson AFB in newly constructed houses that were pretreated with chlordane (unpublished data 1976). Livingston et al. (1981) reported the contamination of houses at Scott AFB following the application of chlordane by subslab injection.

Reports of airborne chlordane in family housing and a lack of information concerning its impact on human health prompted the Air Force Medical Service Center (AFMSC) to request guidance from the National Academy of Sciences (NAS) Committee on Toxicology. The Committee recommended a level of 5 micrograms of chlordane per cubic meter of air ($\mu g/m^3$) as the maximum allowable limit for continuous exposure in the home (NAS 1979). The AFMSC adopted the NAS recommendation and established the following priority for evaluating approximately 6,400 Air Force family housing units for chlordane contamination:

- a. Priority 1: houses treated by subslab injection after construction (Lillie 1981).
 - b. Priority 2: houses treated prior to construction.
- c. Priority 3: houses located on installations where studies were conducted during 1975.

The primary objective of this report is to present the results for follow-up samples collected in priority 1 houses and for initial and follow-up samples collected in priority 2 houses. Additionally, a comparison of the airborne chlordane concentrations in priority 1 and priority 2 houses is provided along with recommendations for future studies.

II. MATERIALS AND METHODS

The airborne chlordane concentration in housing units was determined by collecting one sample from near a heater supply vent in the living room of each house. A tube containing Chromosorb 102 was attached to the suction side of a Millipore miniature vacuum pump and the flowrate of the pump was set at 4 liters/minute using a portable precision rotameter. The pump was allowed to run unattended for two hours. Inside temperature, inside relative humidity, outside high temperature, outside low temperature, and barometric pressure were recorded during the sampling period. The samples were analyzed according to methods established by Thomas and Seiber (1974) and Thomas et al. (1980).

Results from the initial sampling were used to determine if any follow-up action was required. In accordance with DOD Safety and Occupational Health Program Policy Memorandum 81-2 (15 Jul 1981), houses with a chlordane concentration of $\langle 3.5~\mu g/m^3$ remained occupied without further action; houses with a chlordane concentration between 3.5 and 6.5 $\mu g/m^3$ were resampled, two samples per house, to determine if the average concentration exceeded 5 $\mu g/m^3$; and houses with a chlordane concentration of $\rangle 6.5~\mu g/m^3$ were scheduled for corrective action.

III. RESULTS

The chlordane concentration exceeded 5 $\mu g/m^3$ in 35 (4%) priority 1 houses (Table 1). The data were analyzed using analysis of variance, stepwise regression, Pearson's correlation, and Spearman's correlation. There was no correlation between the airborne chlordane level and the inside temperature, inside relative humidity, outside temperature, barometric pressure, number of months posttreatment against termites, or the difference between the inside and outside temperature. Only 2 (<1%) priority 2 houses had a chlordane concentration ≥ 5 $\mu g/m^3$ (Table 2).

TABLE 1: NUMBER OF PRIORITY 1 HOUSES WITH AIRBORNE CHLORDANE CONCENTRATIONS ABOVE AND BELOW THE ACTION LEVEL.

INSTALLATION	<5 μg/m ³	≥5 μg/m³	TOTAL	% <u>≥</u> 5 μg/m²
Arnold	40	0	40	_
Chanute	11	1	12	8
Laughl in	98	2	100	2
Mt. Home	65	3	68	4
•Scott	476	22	498	4
Sheppard	21	0	21	-
Vance	223	7	230	3
TOTAL	934	••35	969	4

^{*}From Livingston et al. 1981

^{**}In a recent status report (Lillie 1982), 49 houses were listed in the ≥ 5 $\mu g/m^3$ category. Only the initial results were available for the status report. After subsequent sampling, the average concentration in 14 of the 49 houses was $\langle 5 \mu g/m^3 \rangle$.

TABLE 2: NUMBER OF PRIORITY 2 HOUSES WITH AIRBORNE CHLORDANE CONCENTRATIONS ABOVE AND BELOW THE ACTION LEVEL.

INSTALLATION	<u>≤</u> 5 μg/m³	<u>></u> 5 μg/m³	TOTAL	% >5 μg/m ³
Blytheville	830	0	830	_
Cannon	760	0	760	_
Lackland	124	1	125	⟨1
Laughl in	397	1	398	<1
TOTAL	2,111	*2	2,113	⟨1

^{*}In a recent status report (Lillie 1982), 3 houses were listed in the $\geq 5~\mu g/m^3$ category. Only the initial results were available for the status report. After subsequent sampling, the average concentration in 1 of the 3 houses was $< 5~\mu g/m^3$.

IV. DISCUSSION

Airborne chlordane can be detected in most houses following treatment for termites, but the probability of exceeding $5~\mu g/m^3$ is low in sub- or intraslab ducted houses that were treated only prior to construction (Table 2). The need to sample such houses in the future (Table 3, Type b) is not necessary because the chlordane concentration was extremely low ($\langle 1~\mu g/m^3 \rangle$ in most houses. Approximately 3,159 houses could be elimated from the 1983-84 sampling schedule.

TABLE 3: NUMBER OF HOUSES CURRENTLY SCHEDULED FOR SAMPLING IN 1983-1984.

INSTALLATION	NO. HOUSES	
USAF Academy CO	9 ⁸	
Bergstrom AFB TX	16 ^a	
Offutt AFB NE	40a 100b*	
Moody AFB GA	100,	
Offutt AFB NE	1,591, ^b	
Wright-Patterson AFB OH		
Langley AFB VA	734 ^b 143 ^b 591 ^c	
Andrews AFB MD	591 ^b	
Hill AFB UT	14 ^c	
McGuire AFB NJ	2 ^c	
Pease AFB NH	72 ^c	
	3,312	

Crawl space houses

The low concentrations of airborne chlordane should not be used to justify construction of sub- or intraslab ducted houses because subsequent treatment to control termites may be required after construction. The probability of exceeding 5 $\mu g/m^2$ is higher in houses treated after construction (Table 1); the pesticide may be forced into cracks in the ducts or slab during high pressure subslab injection. Experience has also shown that pesticide applicators may inadvertently puncture a duct.

There was no correlation between the airborne chlordane concentration and various environmental parameters. Similar results were reported by Livingston et al. (1981) and Wright and Leidy (1982). This is not surprising because only one sample was collected/house and the data were pooled to perform the statistical tests. In order to pool the data, one must assume that all houses are identical in design and procedures used for termite treatment. Such an

Subslab ducted houses treated prior to construction

Subslab ducted houses treated after construction

HQ AFMSC/SGPA 14 July 82 ltr removed Moody from the b class

assumption is invalid. Correlations between the chlordane concentration and weather parameters should not be denied without further study.

V. CONCLUSIONS

- 1. Houses with sub- or intraslab ducts cannot be treated for subterranean termite infestation by subslab i jection because of the possibility of contaminating the living space with termiticide vapors.
- 2. The airborne chlordane level is not likely to exceed 5 $\mu g/m^3$ in subor intraslab ducted houses that were treated only prior to construction.

VI. RECOMMENDATIONS

Future plans to collect samples in the 3,159 houses with sub- or intraslab ducts that were treated only prior to construction should be cancelled. HQ AFMSC/SGPA concurred with this conclusion by letter dated 14 July 1982. Chlordane sampling in sub- or intraslab ducted houses treated prior to construction will be cancelled for those houses in Table 3 with the exception of Moody AFB.

LITERATURE CITED

- Callahan, R.A. 1970. Chlordane contamination of government quarters and personal property. USAF Environmental Health Laboratory/Kelly AFB TX. Tech. Rep. 70-7. 75 pp.
- DOD. 1981. Chlordane in Department of Defense Buildings. Safety and Occup. Hlth. Prog. Policy Memorandum 81-2 (15 Jul 1981) 16 pp.
- Lillie, T.H. 1981. Chlordane in Air Force family housing: a study of houses treated after construction. USAF Occupational and Environmental Laboratory Tech. Rep. 81-45. 27 pp.
- Lillie, T.H. 1982. Chlordane contamination of Air Force family housing.

 Proc. 14th Bioenvironmental Engineering Symp., USAF School of Aerospace
 Medicine. IN PRESS.
- Livingston, J.M., C.R. Jones, and T.H. Lillie. 1981. Airborne chlordane contamination in houses treated for termites at a midwestern Air Force base. USAF Occupational and Environmental Health Laboratory Tech. Rep. 81-11. 34 pp.
- Malina, M.A., J.M. Kearny, and P.B. Polen. 1959. Determination of chlordane in air of habitations treated for insect control. J. Agri. Food Chem. 7:30-33.
- National Academy of Sciences Committee on Toxicology. 1979. Chlordane in Military Family Housing. 10 pp.
- Savage, E.P. 1975. Pesticide residues in houses utilizing forced air plenum distribution systems. Report of the Colorado Epidemiological Pesticide Studies Center. 72 pp.
- Thomas, T.C. and J. Seiber. 1974. Chromosorb 102, an efficient means for trapping pesticides from air. Bull. Environ. Contam. Toxicol. 12:17-25.
- Thomas, T.C., J.W. Jackson, and Y.A. Nishioka. 1980. Chlordene sampling with chromosorb 102 and ethylene glycol. Am. Ind. Hyg. Assoc. J. 41:599-601.
- Vinopal, J.H. and K.L. Olds. 1977. Investigation of suspected nonoccupational human intoxication/chlordane termite treatment, Fort Monmouth NJ. U.S. Army Environ. Hyg. Agency Pesticide Monitoring Special Study No. 44-0957-77. 17 pp.
- Wright, C.G. and R.B. Leidy. 1982. Chlordane and heptachlor in the ambient air of houses treated for termites. Bull. Environ. Contam. Toxicol. 28:617-623.